# ADJUSTABLE COEFFICIENT DIGITAL INDICATORS

DATA OUTPUT

INSPECTION CERTIFICATE
TRACEABLE TO NIST

- DISPLAY READING = COEFFICIENT X SPINDLE MOVEMENT.
  The coefficient can be adjusted from 0 to 9.9999. For example, coefficient is 4.5562, spindle moves 3.60mm, display reading is 4.5562 x 3.60=16.40mm
- Button function: on/off, zero, data preset, inch/mm, coefficient set, measuring direction change
- Keep preset data in memory after restart
- CR2032 battery, automatic power off
- Data output
- Optional accessory: data output cable(code **7306-40**, **7315-40**, **7302-SPC3A**, **7305-C01**, **7305-SPC1A**), backs(page 104~105), contact points(page 102~103)

spindle lift knob is included

2501-10

Unit: mm

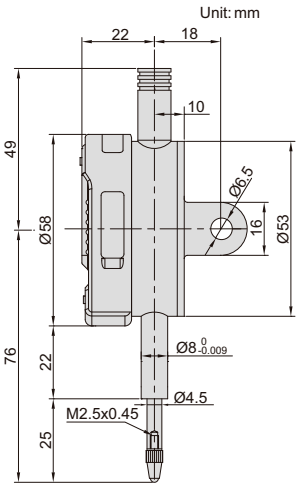


| Code | Range | Resolution | Accuracy | Hysteresis | Remark |
|---|---|---|---|---|---|
| **2501-10*** | 12.7mm/0.5" | 0.01mm/0.0005" | 20μm | 10μm | lug back |
| **2501-10F*** | 12.7mm/0.5" | 0.01mm/0.0005" | 20μm | 10μm | flat back |

*Supplied with manufacturer inspection certificate traceable to NIST USA